

1478

To find con. sec. 14-15-1W, retraced Garrison's work who found I W w SE+ and I E2 SE+ practically equal in length and practically collinear.

Found stone at E gtr. cor. (Bohti "588°W 49.9', Doh 7" E. 58.0'). Stone has E-Wnotch. Found stone 5" Deep 1.4' E. of old wood cor. port for Cen. N. SEt (not sure the stone is the comer but no other stone were found). (not sure the stone is the comer but no other stone were found). [listance between stone roughly measured to be 1325.75' ± 0.8'.

Prolonged the above line W. another 1325.75' (approx.) and dug. Prolonged the above found stone at see, com. about 1.15' ± hole 3' × 3' × 3' deep and found stone at see, com. about 1.15' ± N. of prolonged line and about 1327.2' ± 0.8' W. of stone for M. of prolonged line and about 1327.2' ± 0.8' W. of stone for On. N. SEt. Stone at see, con. pretty close to straight line from N gtr. cor, to S, gtr. cor.

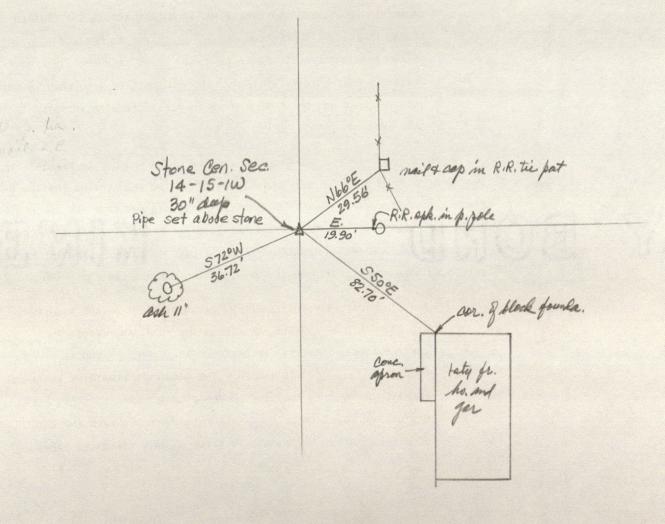

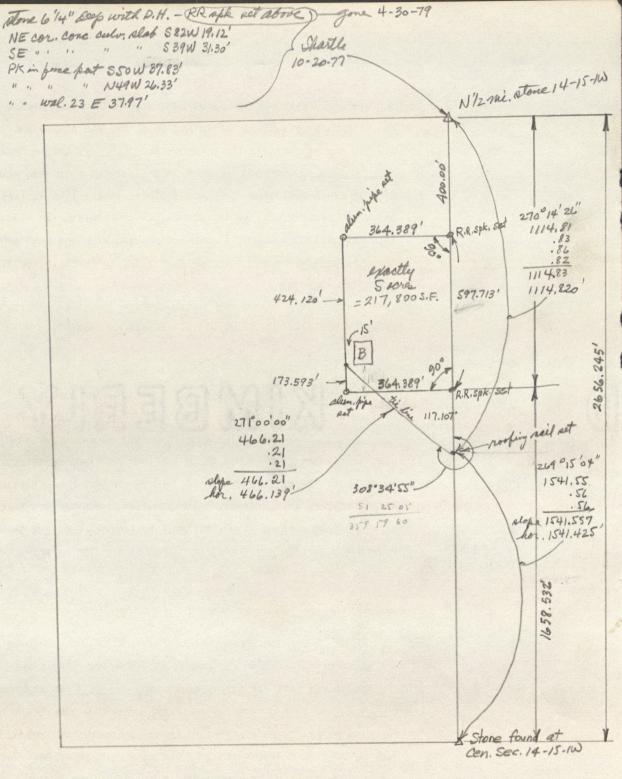

For thee. E. Scott R.R.4, Box 256 Brownsbuy, Ind. 46112 317-852-8124 legal blace, & tron
stakes only - no plat
unless rapuated latera.
House on place: minor
plat not rejil.

cell before going

STRANTLEST ML SHARRINE

REGISTERED PROFESSIONAL ENGINEER REGISTERED LAND SURVEYOR R. R. 1, BOX 33 STILESVILLE, IND. 46180

PHONE 317-539-6225

LEGAL DESCRIPTION FOR MR. THOMAS E. SCOTT

A part of the East Half of the Northwest Quarter of Section 14,

Township 15 North, Range 1 West, Hendricks County, Indiana, described as
follows: Beginning on the east line of said half-quarter section 400.00
feet South of a stone at the northeast corner of said half-quarter section;
thence South on said east line 597.71 feet; thence West at right angles
from said east line 364.39 feet; thence North parallel with said east line
597.71 feet; thence East 364.39 feet to the point of beginning; containing
5.00 acres, more or less. Subject to all legal highways, rights of way,
and easements. The east line of said half-quarter section as marked by
stones at the ends of said line is an assumed meridian upon which all
bearings herein are based.

Given under my hand and seal this 1st day of May, 1979:



Stanley M. Syartle, Registered Land Surveyor No. 3431, State of Indiana

STANLEY M. SHARTLE REGISTERED PROFESSIONAL ENGINEER RURAL ROUTE 1, BOX 33 STILESVILLE, IND. 46180

LOCATION OF MONUMENT: SECTION 14 , T. 15 N., R.1 W. Monument found: Yes No Description: set pipe over original cor. stone Depth: pipe 1 inch; stone 30 inches References taken: April 30, 1979 Comments: bearings are magnetic qtr.cor.stone 2656.24 feet nail & cap in R.R. tie cor.post N66°E 29.56 -- R.R. spike in power pole ash 11"0 COUNTY ROAD 150 EAST corner of block founda. 1-sty.fr.ho. Stanley M. Shartle, P.E & L.S. April 30, 1979 Date

PLEASE REMIT TO

STRANGUERY ML SHARRINGE

REGISTERED PROFESSIONAL ENGINEER
REGISTERED LAND SURVEYOR
R. R. 1, BOX 33
STILESVILLE, IND. 46180

TO: Mr. Thomas E. Scott R.R. 4, Box 256 Brownsburg, Indiana 46112

For professional services rendered as follows:

Surveying, staking, and describing a 5-acre tract of land in Sec. 14-15-1W:

FIELD WORK (including labor of field party, mileage, stakes, instrument rental, etc.) 8 1/4 hrs. at \$35 per hr.....\$288.75