

4,5,6,7,8,9-15-1W COUNTY

1495

Made by
STANLEY M. SHARTLE




under an appointment by the Surveyor of Hendricks County pursuant to §5 of
the Perpetual Corner Records Act of 1965 (Ch. 319) to administer said act.

LOCATION OF MONUMENT: SECTION 4, T. 15 N., R. 1 W.

Found: ☒ Set: ☐ Depth: 1.5 inches

Description: metal plug

x= 17,339.52', y= 22,664.21', based
on a local system of plane rectangular co-
ordinates at ground level with x=20,000.00'
and y=20,000.00' at East Qtr. Cor. 9-15-1W
and the azimuth from Hend. Co. Magnetic Sta.
to its meridian mark, (mire) assumed to be
0°00'00"0. Azimuths on this system are
reckoned clockwise from the north thru 360°.
Bearings to reference objects are magnetic
unless the contrary is shown.

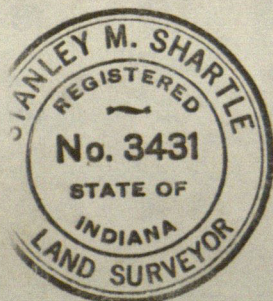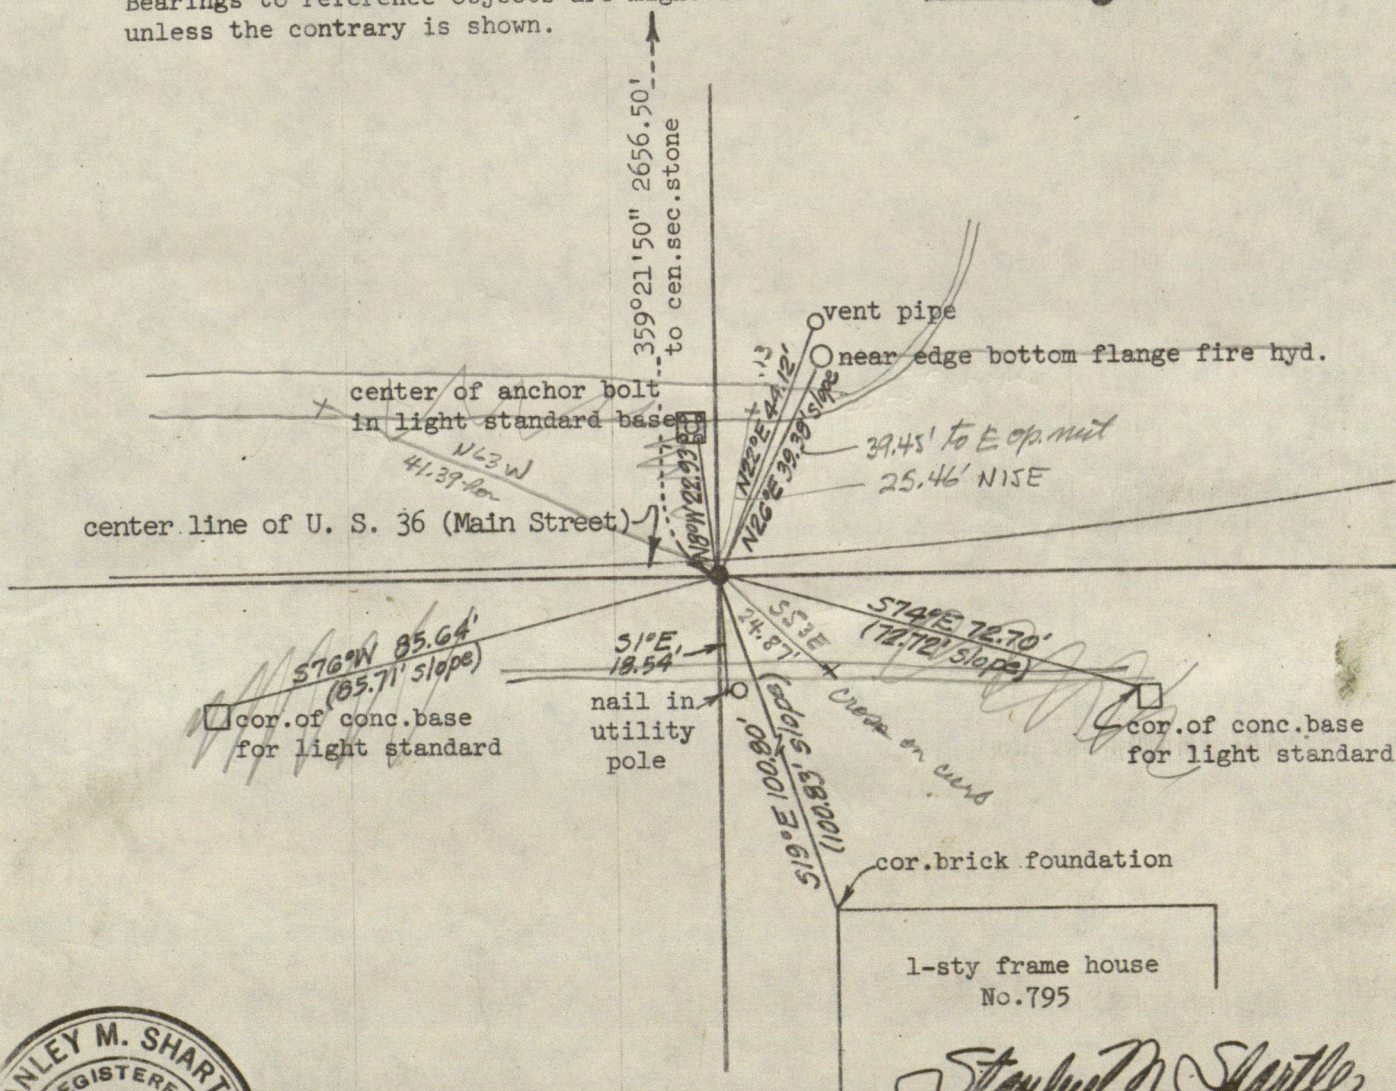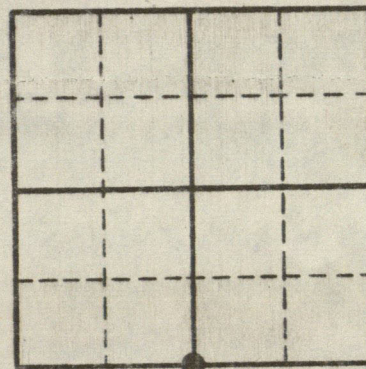

Stanley M. Shartle
Stanley M. Shartle, P.E. & L.S.


Date: April 7, 1978

46


Due to difficulty in setting
the track belt, this distance
actually is 101.50'



	4	***
	59.140	***
	0.000	***
to mail	{ 101.660 }	***
found	{ 101.320 }	***
	0.000	***
	0.000	***
	107.1515	***
	253.2234	***
	28.987	***
	97.085	***
	4	***
	59.140	***
	0.000	***
to true	[101.480]	122
sec. cor.	[101.490]	***
1947	0.000	***
	0.000	***
	106.5551	***
	253.0302	***
	29.587	***
	97.082	***

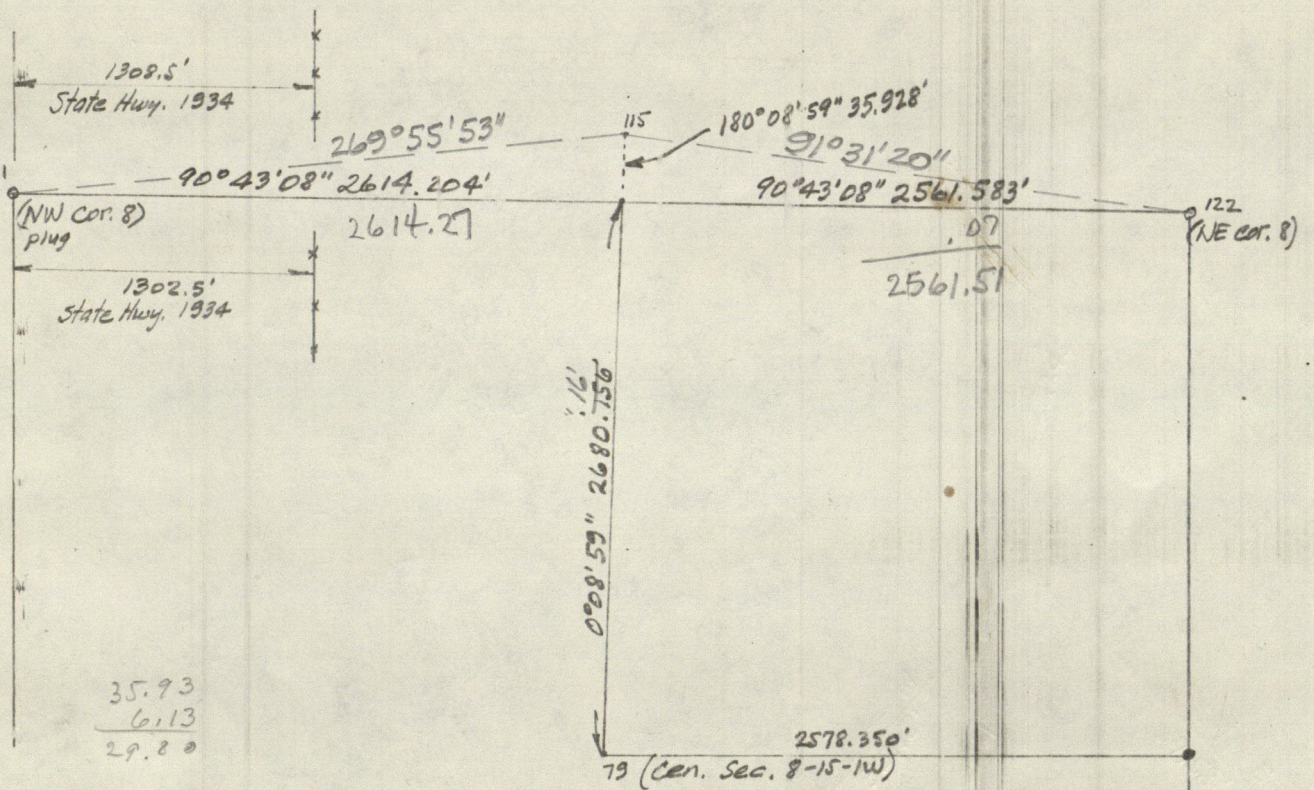

35.93
6.13
29.80

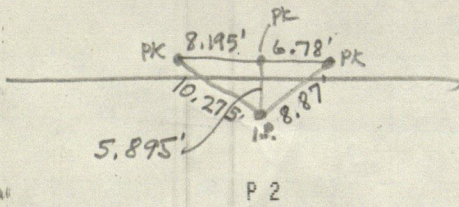


P 2

1	***
9999.970	***
5000.000	***
90.4308	***
180.0859	***
7287.024	***
7606.995	***

P 1

1	***
10003.098	***
7614.087	***
2	***
5	***
9967.170	***
7613.999	***
180.082559	***
35.928	***

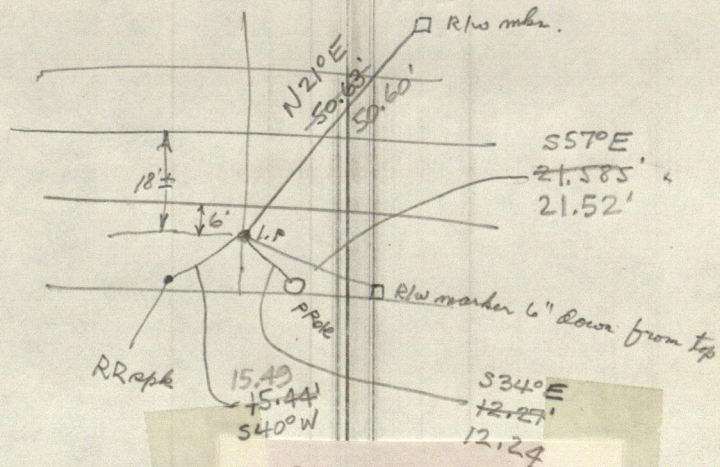

P 1

1	***
115	10003.0980 ***
	7614.0870 ***
3	***
5	***
122	9935.0380 ***
	10175.3800 ***
115-122	91.31197 ***
	2562.1971 ***
1	9999.9700 ***
	5000.0000 ***
115-1	269.55532 ***
	2614.0889 ***

5-15-1W

Marker found: yes ☒ no ☐Type of Marker: Bress Plug



Description: _____

Depth and Marking: SurfaceReferences set: yes ☒ no ☐

Sketch References below.

Date: June 26, 1974 Set by: Alton J. Huntman

Comments:

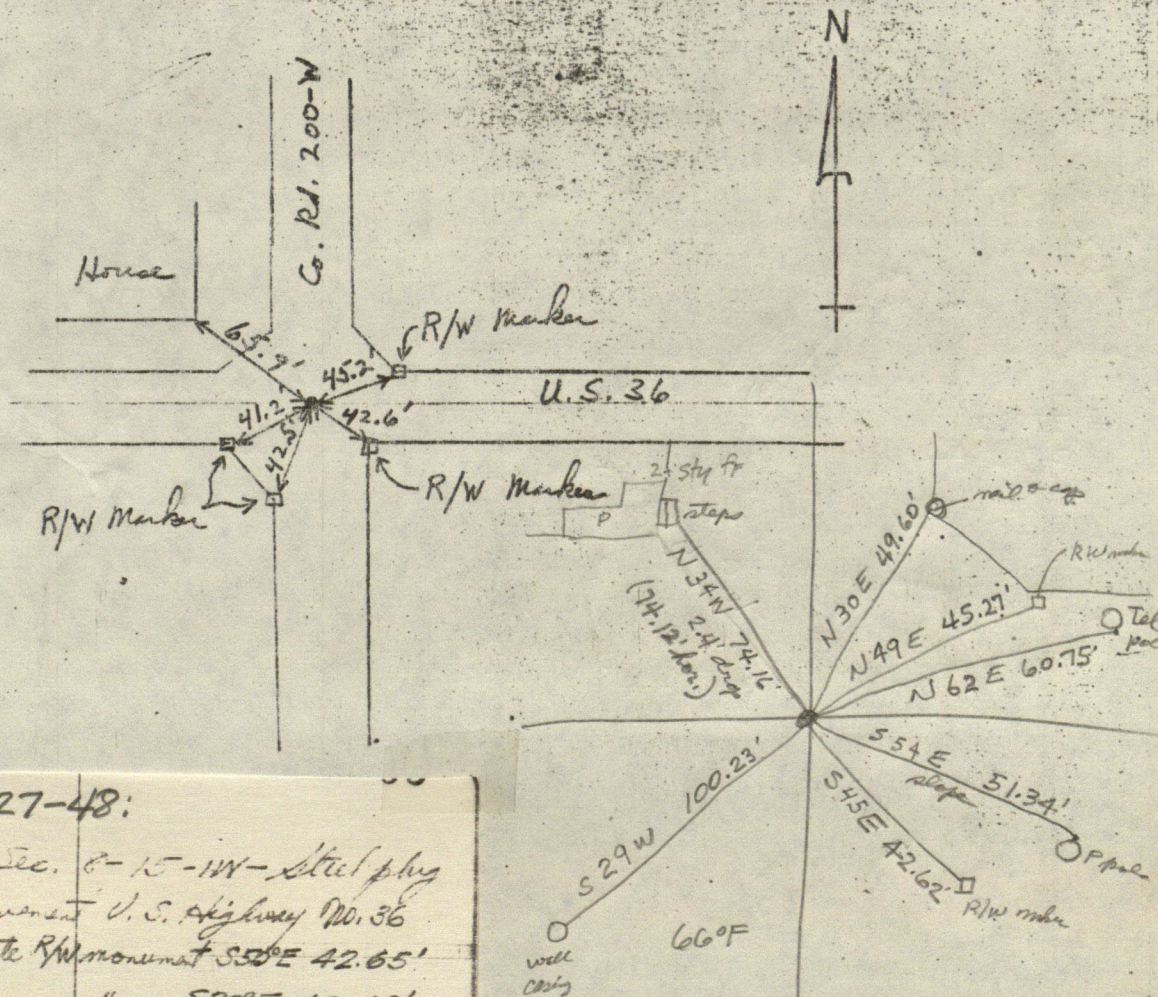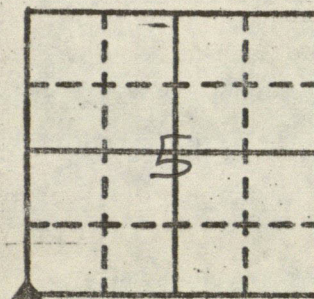with P.H.S. + C.D.N.

Shurtle Q-27-48:

NW 1/4 Sec. 8-15-1W-Steel plug
found in E pavement U.S. Highway No. 36
Near corner concrete R/W monument S 50° E 42.65'
" " " S 30° E 42.48'
" " " S 50° W 41.34'
" " " N 50° W 42.84'
" " " N 50° E 45.25'
" " " N 30° E 39.29'
" " " N 50° E 43.08'

HENDRICKS COUNTY SURVEYOR

STANLEY M. SHARTLE
 REGISTERED PROFESSIONAL ENGINEER
 RURAL ROUTE 1, BOX 33
 STILESVILLE, IND. 46180



LOCATION OF MONUMENT: SECTION 6, T. 15 N., R. 1 W.

Monument found: Yes No ☒

Description: 3/8" x 4" carriage bolt
in blacktop overlay
 Depth: flush


References taken: September 11, 1977

Comments: Bearings are magnetic

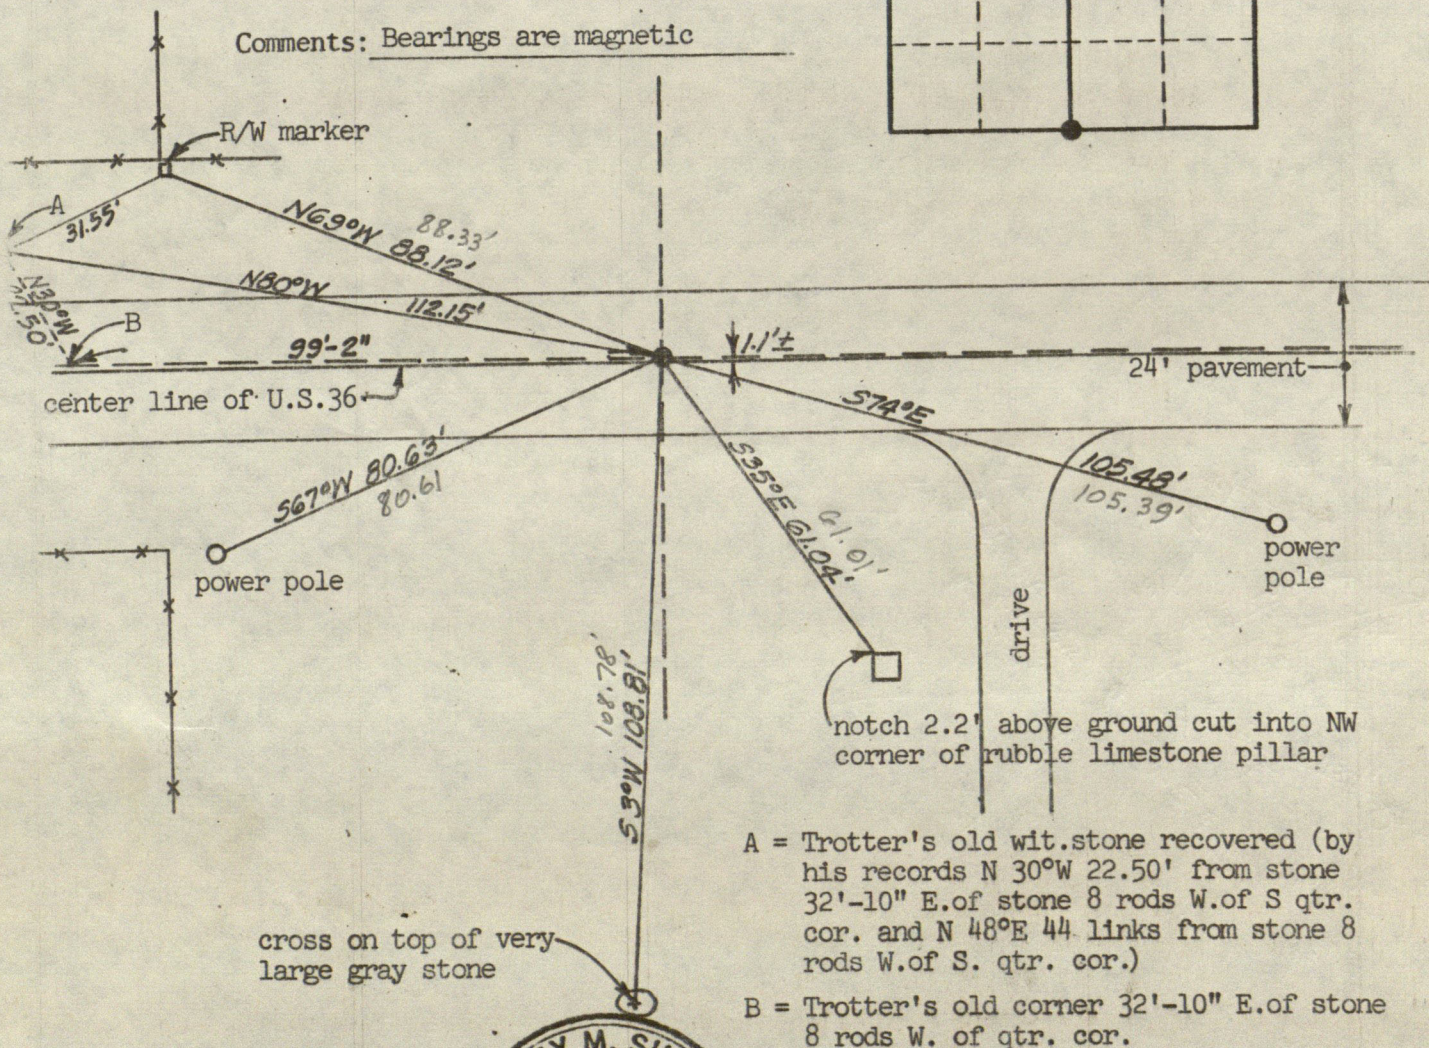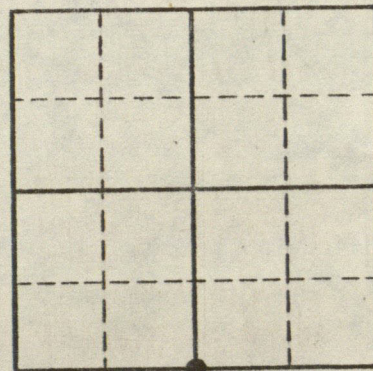

A = Trotter's old wit. stone recovered (by his records N 30° W 22.50' from stone 32'-10" E. of stone 8 rods W. of S qtr. cor. and N 48° E 44 links from stone 8 rods W. of S. qtr. cor.)

B = Trotter's old corner 32'-10" E. of stone 8 rods W. of qtr. cor.

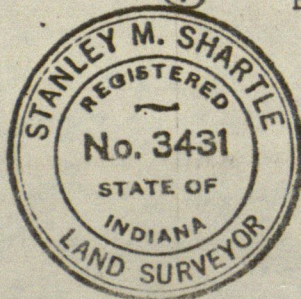

Stanley M. Shartle
 Stanley M. Shartle, P.E & L.S.

September 12, 1977

Date

STANLEY M. SHARTLE
 REGISTERED PROFESSIONAL ENGINEER
 RURAL ROUTE 1, BOX 33
 STILESVILLE, IND. 46180



LOCATION OF MONUMENT: SECTION 6, T. 15 N., R. 1 W.

Monument found: Yes No ✓
 Description: 3/8"x4" carriage bolt set
in blacktop overlay

Depth: Flush with surface

References taken: September 10, 1977

Comments: Bearings are magnetic

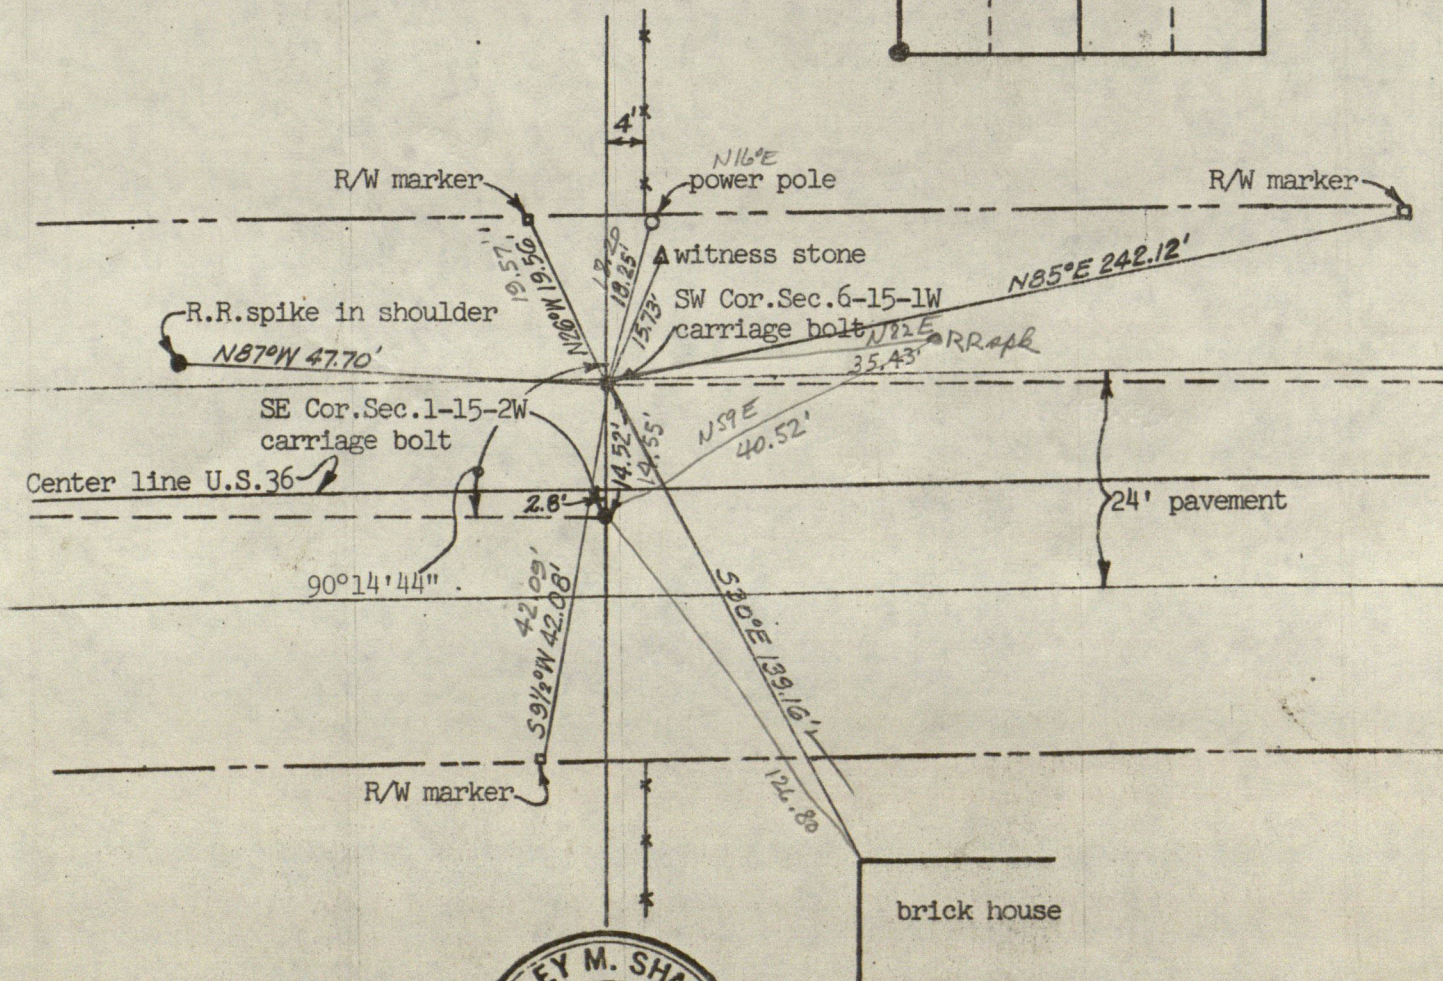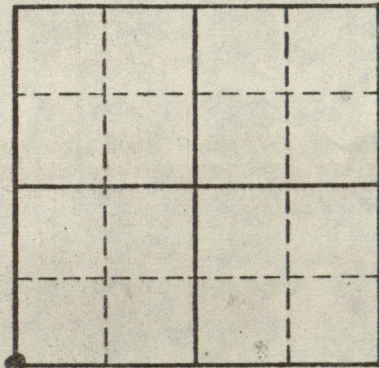

Stanley M. Shartle

Stanley M. Shartle, P.E. & L.S.

September 10, 1977

Date

HENDRICKS COUNTY

DESIGNATION OF MARKER S.W. Corner SEC. 6 T. 15 N. 1W R.

Marker found: yes ☒ no ☐

Type of Marker: Stone

Description: Blue Granite


Depth and Marking: 1 ft. below Surface

References set: yes ☒ no ☐

Sketch References below.

Date: June 26, 1974 Set by: Alton J. Huntarian
with P.K.S. & C.D.N.

Comments:

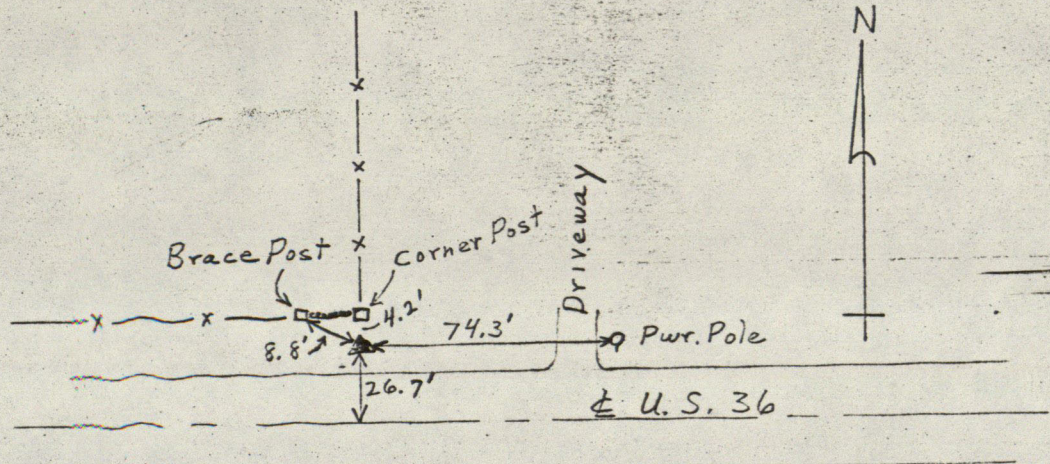

Not a section corner.
See S.M. Shortle
for information.

HENDRICKS COUNTY

DESIGNATION OF MARKER S.W. Corner SEC. 5 T. 15 N. 1W R.

Marker found: yes ☒ no ☐

Type of Marker: Bress Plug

Description: _____



Depth and Marking: Surface

References set: yes ☒ no ☐


Sketch References below.

Date: June 26, 1974 Set by: Alton J. Huntman
with P.H.S. + C.D.H.

Comments:

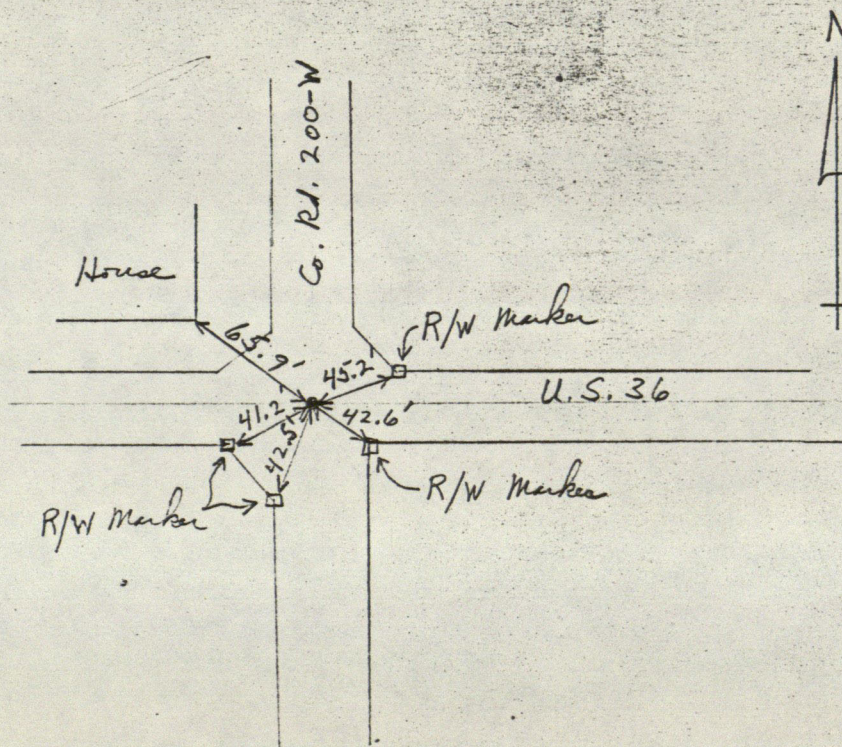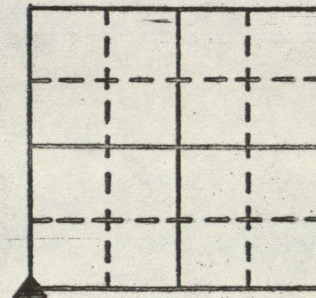

HENDRICKS COUNTY SURVEYOR

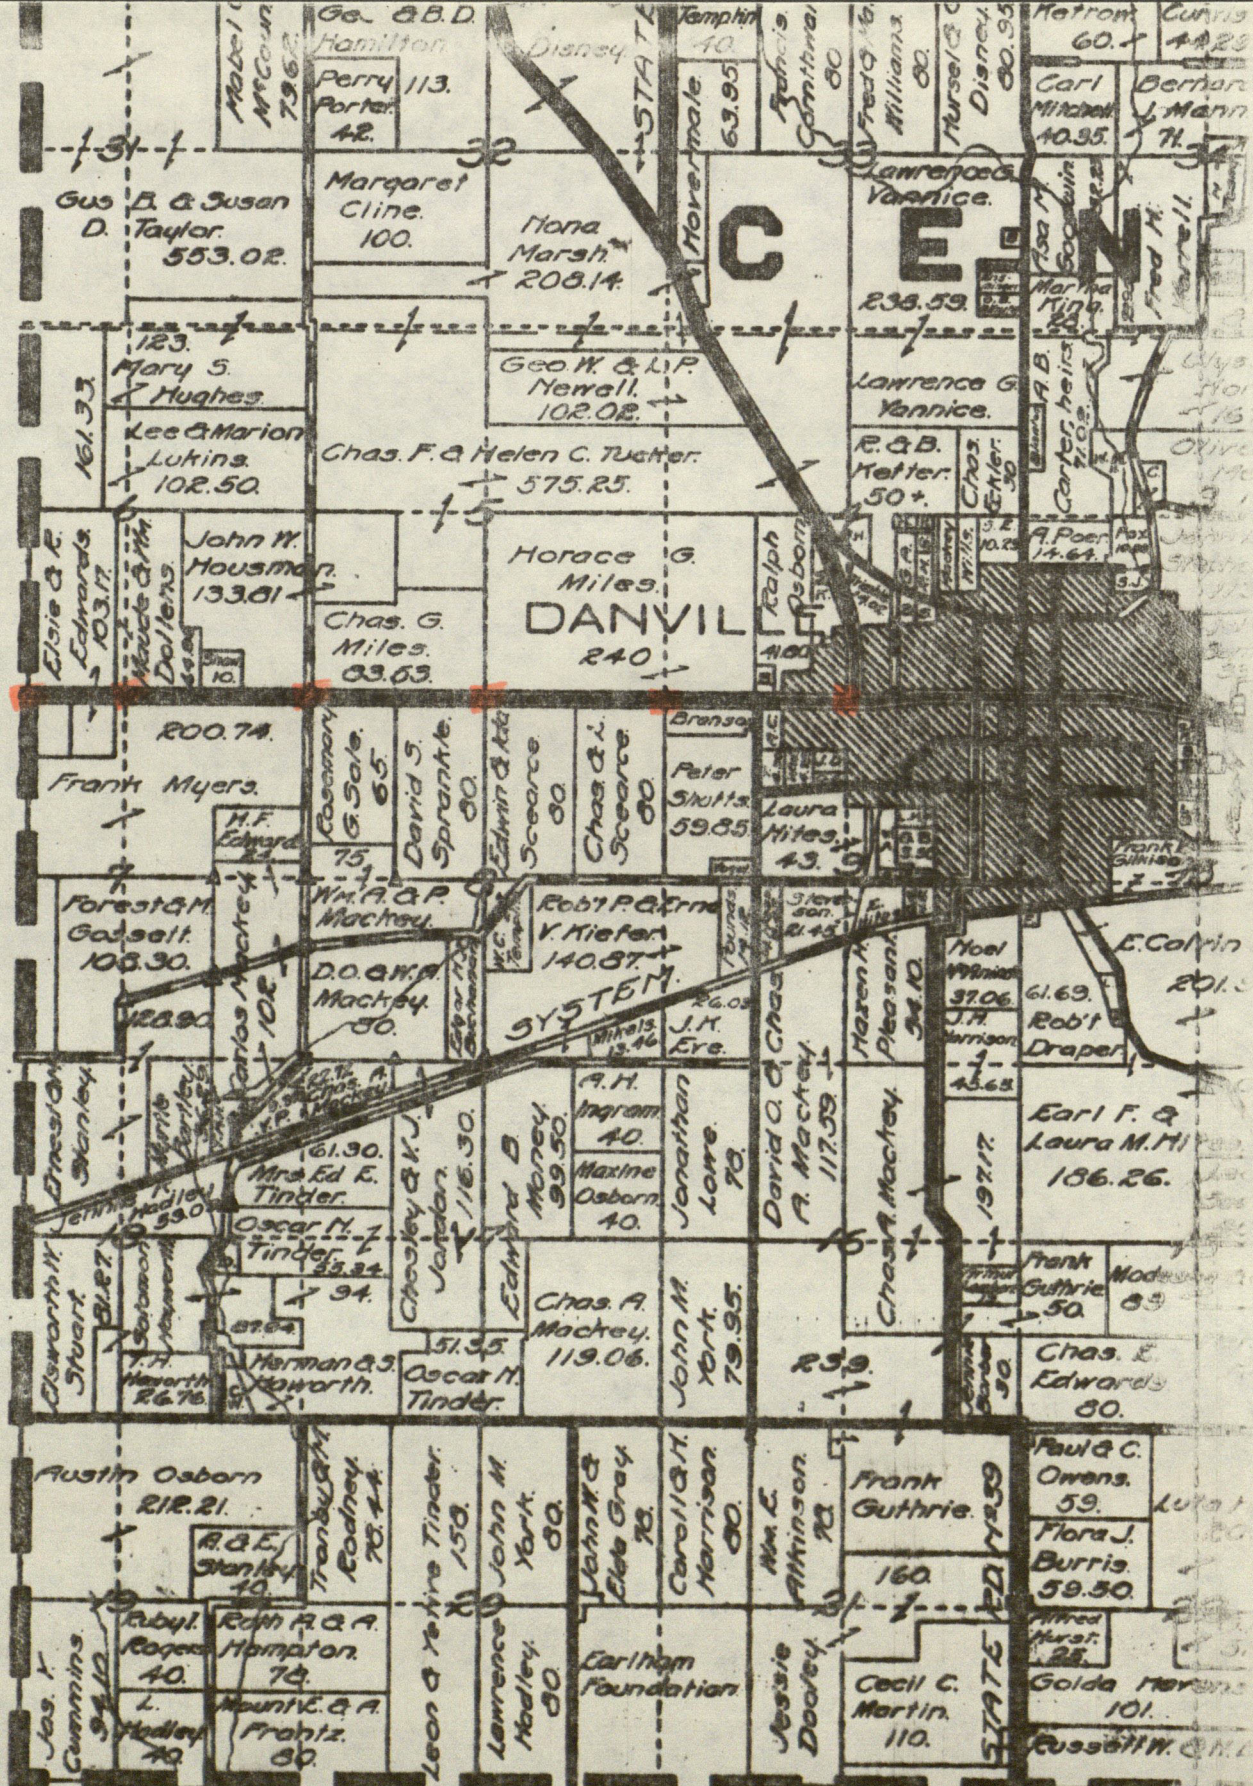


RECORD OF CORNER

LOCATION OF MONUMENT: SECTION 8, T. 15 N., R. 1 W.

Found: Set: ✓ Depth: 2 inches

Description: Plastic cap set in concrete monument

Bearings to reference objects are magnetic unless a contrary mode is shown.

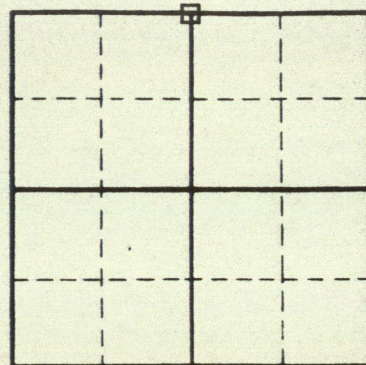

PAVEMENT OF U. S. 36

2614.27' to sec. cor. plug

RIGHT OF WAY MARKER

180° 00'

2561.51' to sec. cor. plug

RAILROAD SPIKE FLUSH

RIGHT OF WAY MARKER
CAP NAILED TO POWER POLE

2680.16' to cen. of sec.

This corner was restored on a straight line connecting the northwest and northeast corners of the section; however, instead of positioning the corner by single proportionate measurement, I used collateral evidence furnished by fences at the corner and at the 16th section corner to the west. I believe a chaining error occurred in the original government survey.



Stanley M. Shartle
Stanley M. Shartle, P.E. & L.S.

Date: November 7, 1986

RECORD OF CORNER



LOCATION OF MONUMENT: SECTION 9, T. 15 N., R. 1 W.

Found: ☒ Set: ☐ Depth: flush with pavement

Description: brass plug

Bearings to reference objects are magnetic unless a contrary mode is shown.

This corner was obliterated and was restored from my references of June 18, 1947, on which date I used Logan's tacks in his old reference stakes that were still standing.

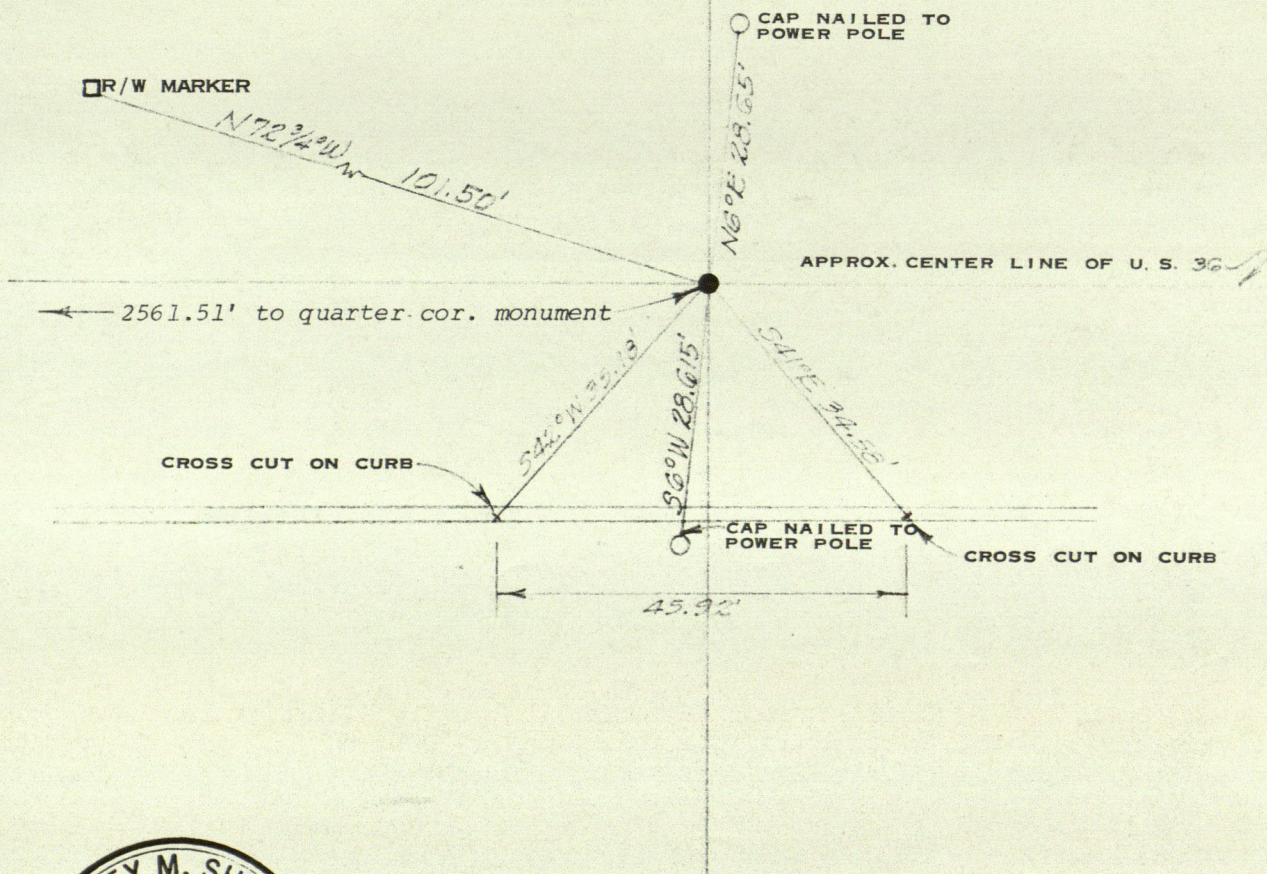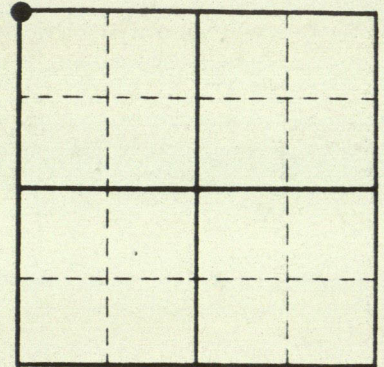

Stanley M. Shartle
Stanley M. Shartle, P.E. & L.S.

Revised November 7, 1986
Date: May 30, 1984